


GENERAL ELEVATION NOTES:

- A. DO NOT SCALE FROM THE DRAWINGS. ALL DIMENSIONS ARE APPROXIMATE. ACTUAL FIELD VERIFIED DIMENSIONS SHALL BE OBTAINED BY THE GENERAL CONTRACTOR OR THE APPLICABLE SUB-CONTRACTORS BEFORE SUBMITTING SHOP DRAWINGS, ORDERING MATERIALS, OR THE COMMENCEMENT OF CONSTRUCTION.
- B. REFER TO THE SPECIFICATIONS FOR THE REQUIREMENT FOR WORKING IN AREAS WHERE LEAD PAINT HAS BEEN IDENTIFIED.
- C. REFER TO THE SPECIFICATIONS FOR THE IDENTIFICATION AND DISPOSAL OF FLUORESCENT LIGHTS AND BALLASTS IN EXISTING FIXTURES.
- D. REFER TO THE SPECIFICATIONS FOR REQUIRED SAFETY MEASURES REQUIRED FOR THE EXCAVATION OF SOILS SURROUNDING THE MAURICE STRUCTURE WHERE ELEVATED LEVELS OF METALS WERE IDENTIFIED.

KEYNOTES

02.07	REFERENCE THE ROOF PLAN FOR ALL WORK REQUIRED AT THE ROOFS AND SKYLIGHTS.
03.682	033000 - EXTERIOR: NEW CONCRETE CAP. REFERENCE CIVIL. FILL WILL BE REQUIRED PRIOR TO INSTALLING NEW CAP.
03.683	033000 - INSTALL NEW CONCRETE WINDOW SILL AT WINDOW 013 (1 EA). SILL WILL NEED TO BE INTEGRAL WITH NEW CONCRETE RUNNELS.
07.600	REFERENCE ROOF PLAN FOR TREATMENT RECOMMENDATIONS, TYPICAL.
07.601	076200 - INSTALL NEW DOWNSPOUT AND EXTENSION AT EXISTING INTERNAL GUTTER EXIT HOLE. WATER TO BE DIRECTED AWAY FROM BUILDING.
08.01	081113, 081433, 087100 - REFERENCE FLOOR PLANS, THE DOOR SCHEDULE, AND SPECIFICATIONS FOR WORK REQUIRED FOR DOORS.
08.11	080152.61, 099113, 099123 - RESTORE HISTORIC WOOD WINDOW. REFERENCE WINDOW SCHEDULE FOR REQUIRED REPAIRS. PREP, PRIME, AND PAINT ALL EXISTING WOOD WINDOW TO REMAIN. INSTALL NEW EXTERIOR STORM WINDOW. REFERENCE WINDOW SCHEDULE.
08.14	088000, 099113, 099123 - INSTALL REPLICA WOOD WINDOWS WITH INSULATED GLAZING, REFERENCE WINDOW SCHEDULE. PREP, PRIME, AND PAINT ALL NEW WINDOWS.
08.600	088000, 099113, 099123 - INSTALL REPLICA WOOD WINDOW. REFERENCE WINDOW SCHEDULE. PREP, PRIME, AND PAINT. INSTALL NEW INTERIOR STORM WINDOW. REFERENCE WINDOW SCHEDULE.
08.602	092300, 092400 - PREP EXISTING WINDOW OPENING FOR NEW CUSTOM STEEL WINDOWS TO MATCH THE HISTORIC CONDITION AT SUN PORCH. DAMAGED INTERIOR PLASTER AND EXTERIOR STUCCO DURING INSTALL SHALL BE REPAIRED IN KIND.
09.600	099113 - PREP AND PAINT EXTERIOR WALLS (ROUGHLY 2050 SF).
09.602	093013 - REPAIRS AREAS OF CRACKED TILE GROUT. REINSTALL SALVAGED TILE, RESET, AND GROUT (100 LF).
09.603	062013, 099113 - REPAIR EAVES. PREP, PRIME, AND PAINT.
09.604	092400 - REPAIR CRACKS IN STUCCO (ROUGHLY 300 LF).
09.612	099113 - PREP, PRIME, AND PAINT NEW AND EXISTING RETAINING WALL TO MATCH EXISTING. ENSURE REPLACEMENT CONCRETE HAS CURED PRIOR TO PAINTING.
23.02	NEW MECHANICAL EQUIPMENT AND/OR ASSOCIATED DEVICES, REFERENCE MECHANICAL DRAWINGS.
26.02	EXISTING LIGHT FIXTURE TO BE CAREFULLY REINSTALLED, REFERENCE ELECTRICAL.

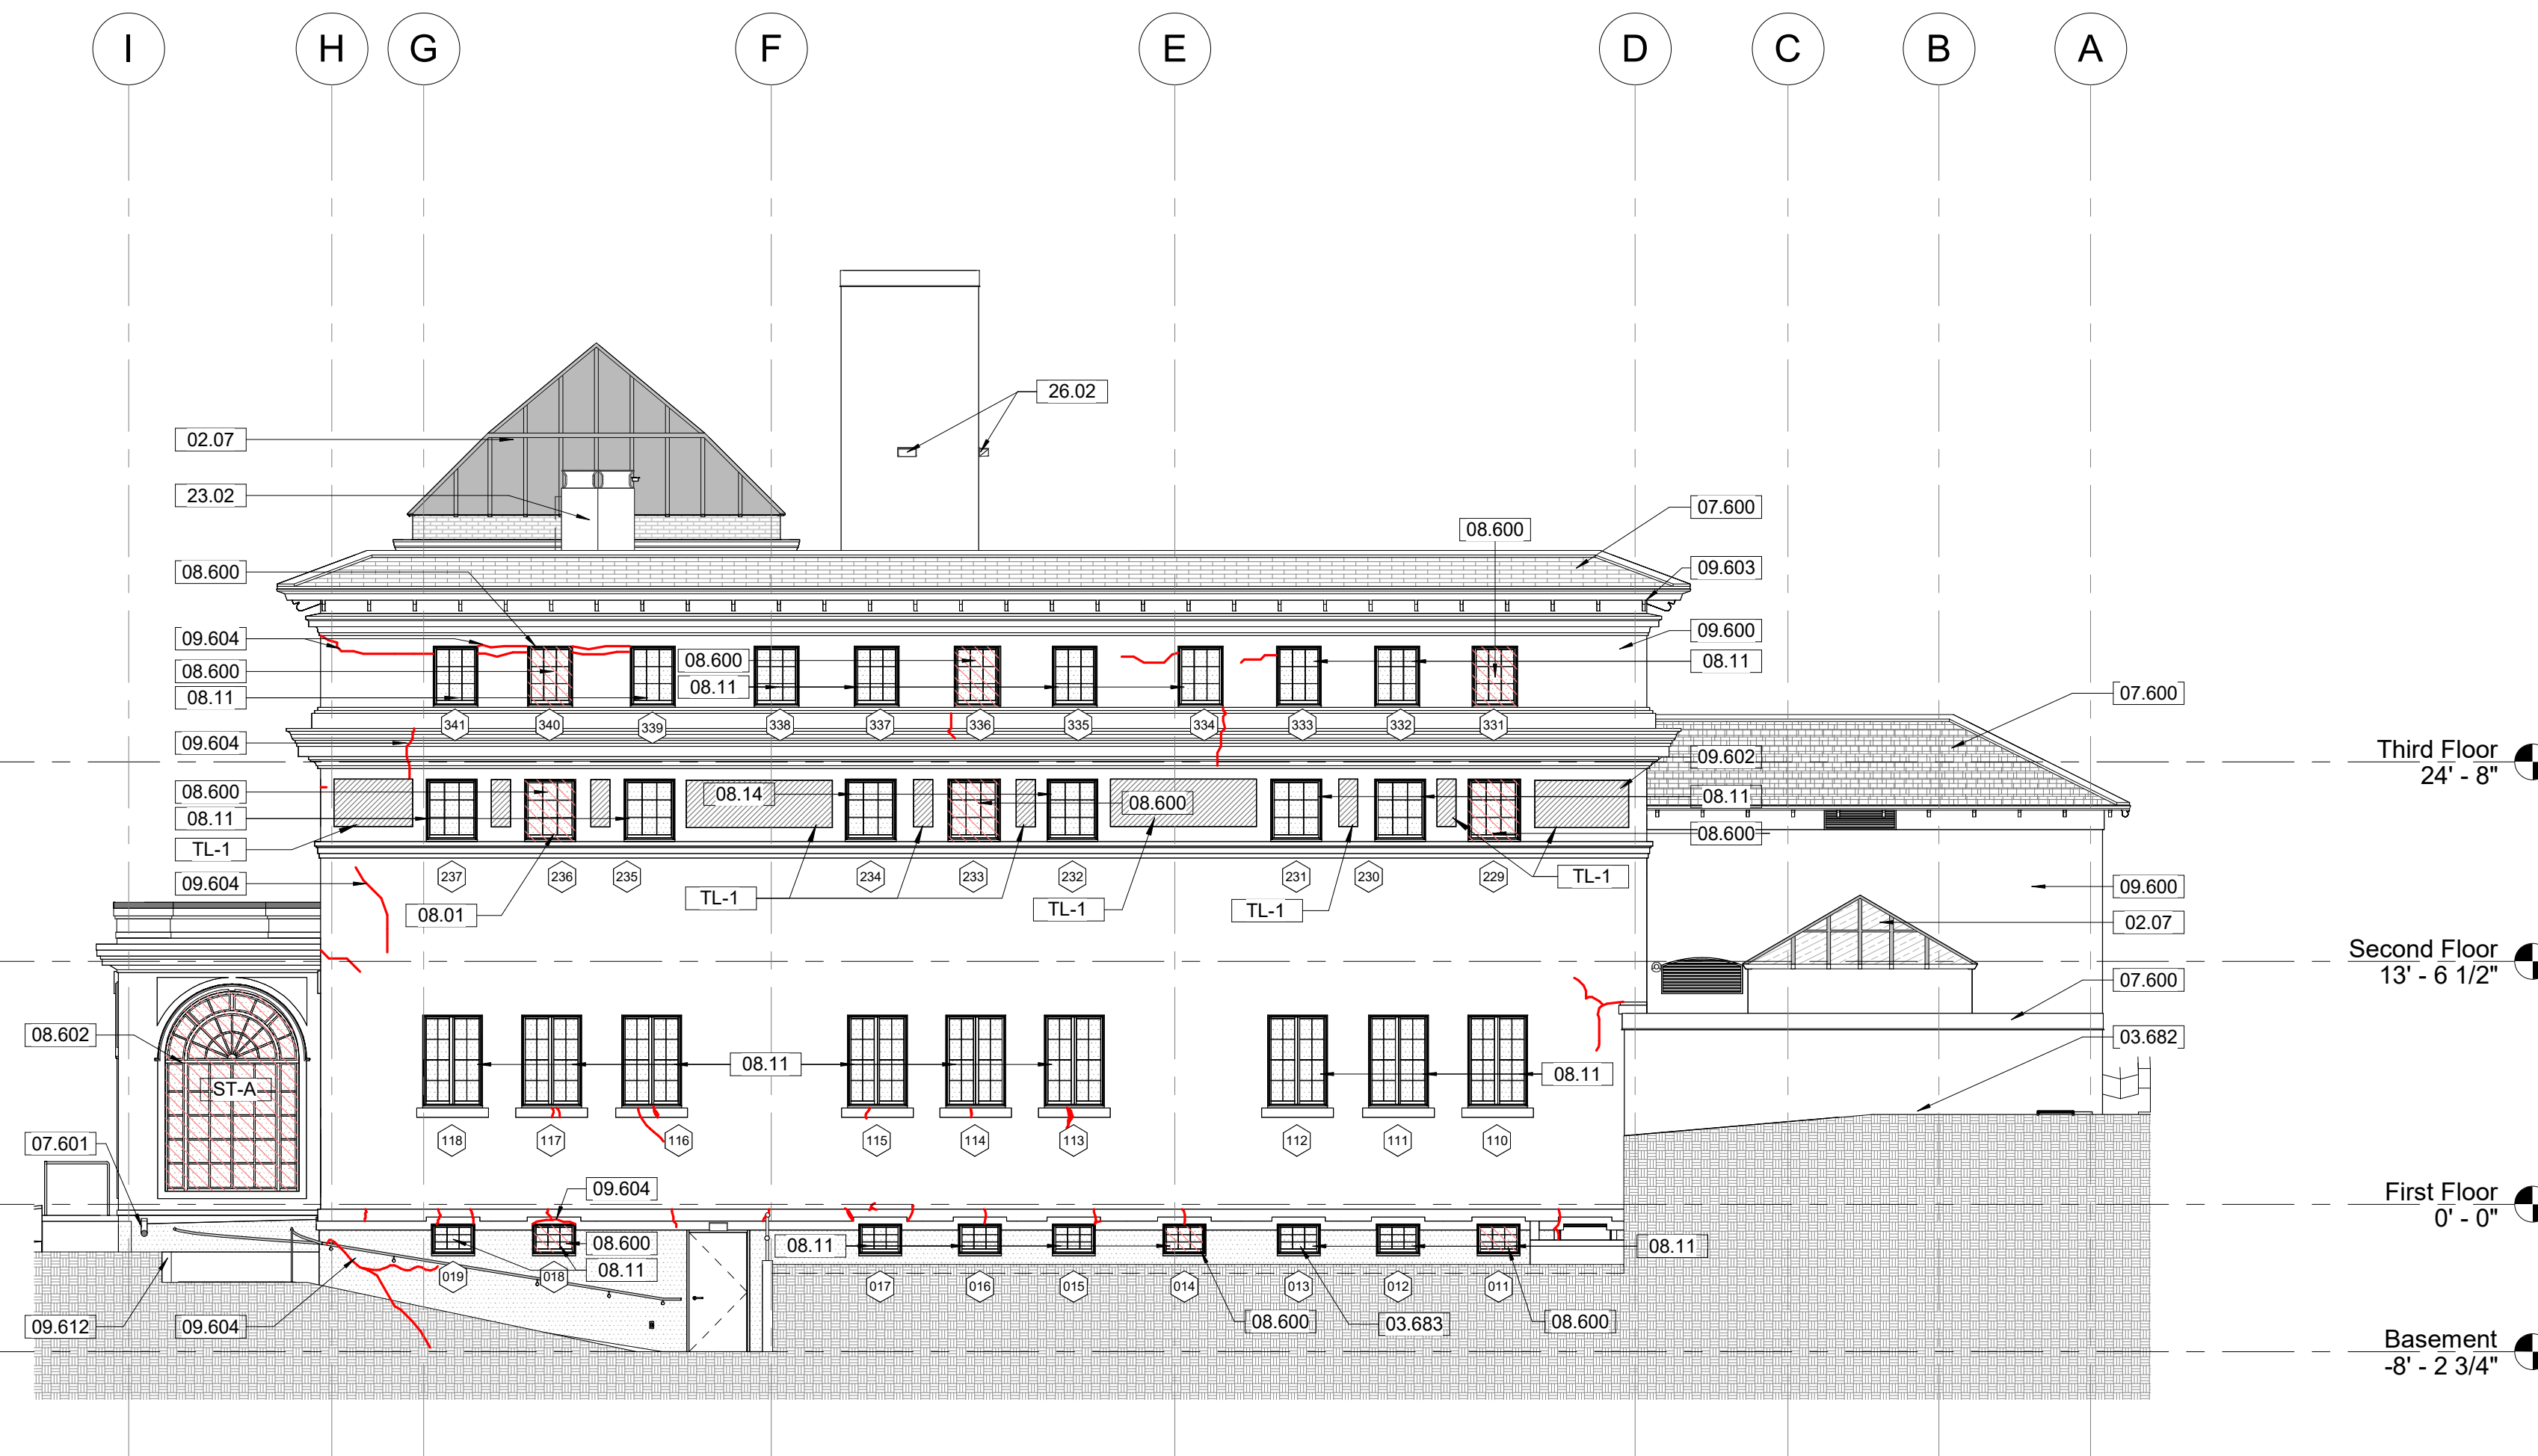

1 South Elevation
A2.3 1/8" = 1'-0" SCALE (A)

ELEVATION TREATMENT LEGEND

	REPLACEMENT MATERIAL INSTALLED (INCLUDING WINDOWS, DOORS, RETAINING WALLS, ETC)
TILE	
	TL-1 REPAIR AREAS OF CRACKED TILE GROUT, EXISTING TILE TO REMAIN IN PLACE (50 SF). CONTRACTOR TO TAKE GREAT CARE OF EXISTING HISTORIC TILES. REPLACEMENT HISTORIC TILES ARE NOT AVAILABLE.
STUCCO	
	ST-1 REMOVE LOOSE, DAMAGED AND /OR STRUCTURAL UNSOUND STUCCO AND REPLACE WITH NEW STUCCO.
	ST-2 REMOVE BIOLOGICAL GROWTH FROM STUCCO (N-20 SF, W-15 SF; TOTAL 150 SF). PER SECRETARY OF INTERIOR'S STANDARDS USE THE GENTLEST MEANS POSSIBLE IN ORDER TO PRESERVE THE HISTORIC FABRIC. NO SANDBLASTING, CHEMICALS, OR HIGH PRESSURE SPRAY. REFERENCE SPECIFICATIONS.
	REPAIR CRACKS

THIS PAGE WAS PREPARED WITH COLORED LINES AND HATCHES. WHEN PRINTING, USE COLOR.

11/8/2023 3:38:45 PM



A/E FIRMS
 PRIME/ARCH:
STRATA ARCHITECTURE
 1701 OAK STREET,
 SUITE 100
 KANSAS CITY, MO
 T: 816.474.0900

DESIGNED:
CA/AG
 CADD:
CA/ZA/EM
 TECH. REVIEW:
AG
 DATE:
10.27.2023

SUB SHEET NO.
01
A2.3

TITLE OF SHEET
MAURICE BATHHOUSE
SOUTH ELEVATION
 REHABILITATE BATHHOUSES
 HOT SPRINGS NATIONAL PARK

DRAWING NO.
128
182951
 PMIS/PKG NO.
 318915
 SHEET
 56 OF 286